

# **Navajo Abandoned Uranium Mine**

## **Site Screen Report**

*This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.*

*The purpose of the form is to ascertain the status and location of the identified AUM site, and to record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.*

### **Mesa II, Mine No. 1, P-150 AUM Site**

#### **Navajo AUM Northern Region**

**Prepared by:**

**Weston Solutions, Inc.**

**Contract: W91238-06-F-0083**

**12767.063.496.1111**

**March 2010**

**Part I Site Identification, Location and Status****Site Names and ID numbers as applicable****Mine ID:** 602**Map ID:** N244**CERCLIS:** NNN000908911**Navajo Abandoned Mine Land Reclamation Program:** NA-0312**Local name / Aliases:** Mesa 2 - Mine #1 (P-150)**Chapter and local area:** Cove Chapter**County:** Apache**State:** Arizona**Lat/Long:** 36.5127277275 N / -109.232749904 W**Nearby road and highway:** Indian Route 33**Local Post Office:** Cove, AZ**Surface Land Status: check one or more and provide ownership and contact information below****Tribal Trust Land**☒**Public lands**☐**Private**☐**Tribal Fee Land**☐**Bureau of Land Mgmt**☐**Allotment**☐**State**☐**Fee land**☐**Subsurface Mineral Rights:**

No information on subsurface mineral rights ownership was found in the EPA/AUM Database.

**Claim and operator information:**

The mine site surface land status is classified as Tribal Trust Land. Historical information showed the operator from 1952-1955 as Kerr-McGee. No additional ownership / lease information was identified in the EPA/AUM database.

**Number of residential structures within 200 feet of mine:**

None

**Estimated volume of mine waste onsite:**463 yd<sup>3</sup>

## Part II Summary of radiological readings

### Highest gamma radiation measurement:

15,203 counts per minute (cpm)

### Describe any other radiological measurements:

Weston was unable to access the site, due to steep grades. Measurements were collected in the vicinity of the, at approximately 75' north of the site boundary A total of 244 gamma radiation measurements were collected near mine site, ranging from 7,212 cpm to 15,203 cpm. . The measurements are represented in Figures 1 and 2.


### Background Locations

#1 7,906 cpm

**Average background = 7,906 cpm**

### Distribution Chart and Statistics:

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

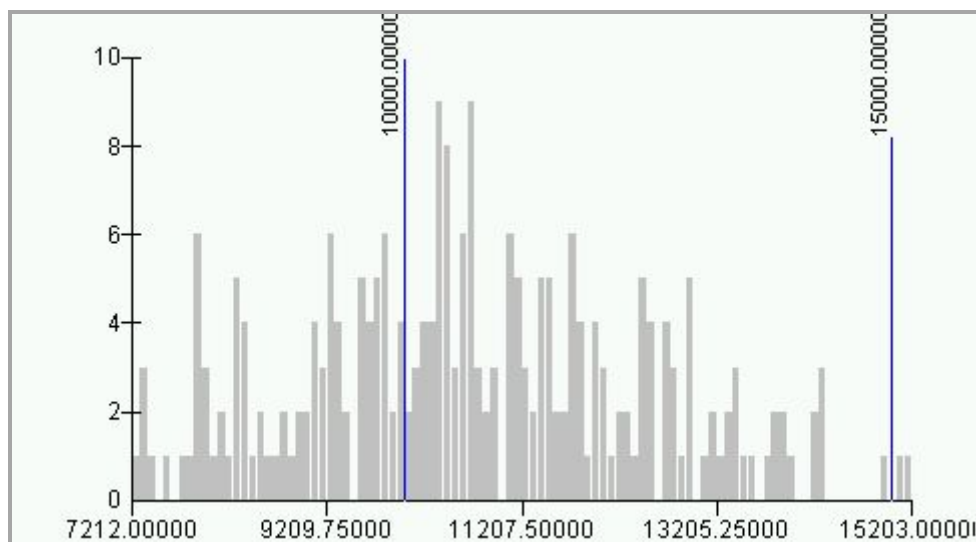

Count:	244
Minimum:	7212.00000
Maximum:	15203.00000
Sum:	2612209.00000
Mean:	10705.77459
Median:	10592.00000
Standard Deviation:	1740.28277

### **Part III      Status of Reclamation and Mine Waste**

**NAMLRP Status of the mine site: Reclaimed : Yes      Waste Pile onsite : Yes**

**NAMLRP Project Number: NA-0312**

**NAMLRP Mine features: 1 Portals**

---

#### **Onsite Observations**

**Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.**

#### **Observed reclamation work and status:**

##### **Adits**

None

##### **Waste Piles**

Cliff face waste, 50' x 50', with a total estimated volume of 463 yd<sup>3</sup>.

##### **Pits**

None

##### **Shafts**

None

#### **Other Debris and Mine Features**

No other mine features were observed during the site visit.

## **Part IV**

### **Site observations and Environs**

**Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:**

**0 to 200 feet:** None

**200 feet to 0.25 mile:** None

**Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:**

**0 to 200 feet:** None

**200 feet to 0.25 mile:** None

**Levels measured around the perimeter(s) of the identified structure(s):**

None

**Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:**

**0 to 0.25 miles:** None

**0.25 miles to 4 miles:** None

**Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.**

None observed

**Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.**

Mesa II, Mine No 1, P-150 mine consists of an area of 15,583.56 square meters. Historical information showed the operator from 1952-1955 as Kerr-McGee. No additional ownership / lease information was identified in the EPA/AUM database.

**Part V            Response Action Summary**

**Site Name(s):** Mesa II, Mine No 1, P-150      **Chapter:** Cove

**Decision Criteria**

**Is there an unreclaimed waste pile at the site?** Yes

**At what distance from the waste pile is the nearest residential structure located?** None

**At what distances from the waste pile are there potential drinking water sources?** None

**Is there a reclamation cap or sealed adit in place at the site?** No

**Is the cap/seal functionally intact?** None

**Is the cap/seal sufficiently degraded to create a concern about releases?** No

**At what distance from the cap/seal is the nearest domestic structure located?** None

**At what distance from the cap/seal is the nearest domestic drinking water source?** None

**Summary of emergency response factors**

None

**Summary hazard ranking system factors**

None

**Summary of reclamation factors**

Unreclaimed waste pile

## Part VI      Photos



Photo 1. Looking down on mine site



Photo 2. Looking down into mine site

**Part VII      Contacts Reports and Information**Name: Stanley Edison (928) 871-6861Eugene Esplain (928) 871-7331Title or official role (if any) Navajo EPA Superfund ProgramAddress PO Box 2946, Window Rock, AZ 86515Information provided Lead Regulatory Agency

---

Name \_\_\_\_\_

Title or official role (if any) \_\_\_\_\_

Address \_\_\_\_\_

Telephone number \_\_\_\_\_

Information provided \_\_\_\_\_

---

Name \_\_\_\_\_

Title or official role (if any) \_\_\_\_\_

Telephone number \_\_\_\_\_

Information provided \_\_\_\_\_

---

Name \_\_\_\_\_

Title or official role (if any) \_\_\_\_\_


Telephone number \_\_\_\_\_

Information provided \_\_\_\_\_

---



**Figure 1 - Gamma Radiation Measurements, Above Two Times Background  
Mesa II Mine 1 P-150 (602)  
Cove Chapter, Navajo Nation, Arizona**

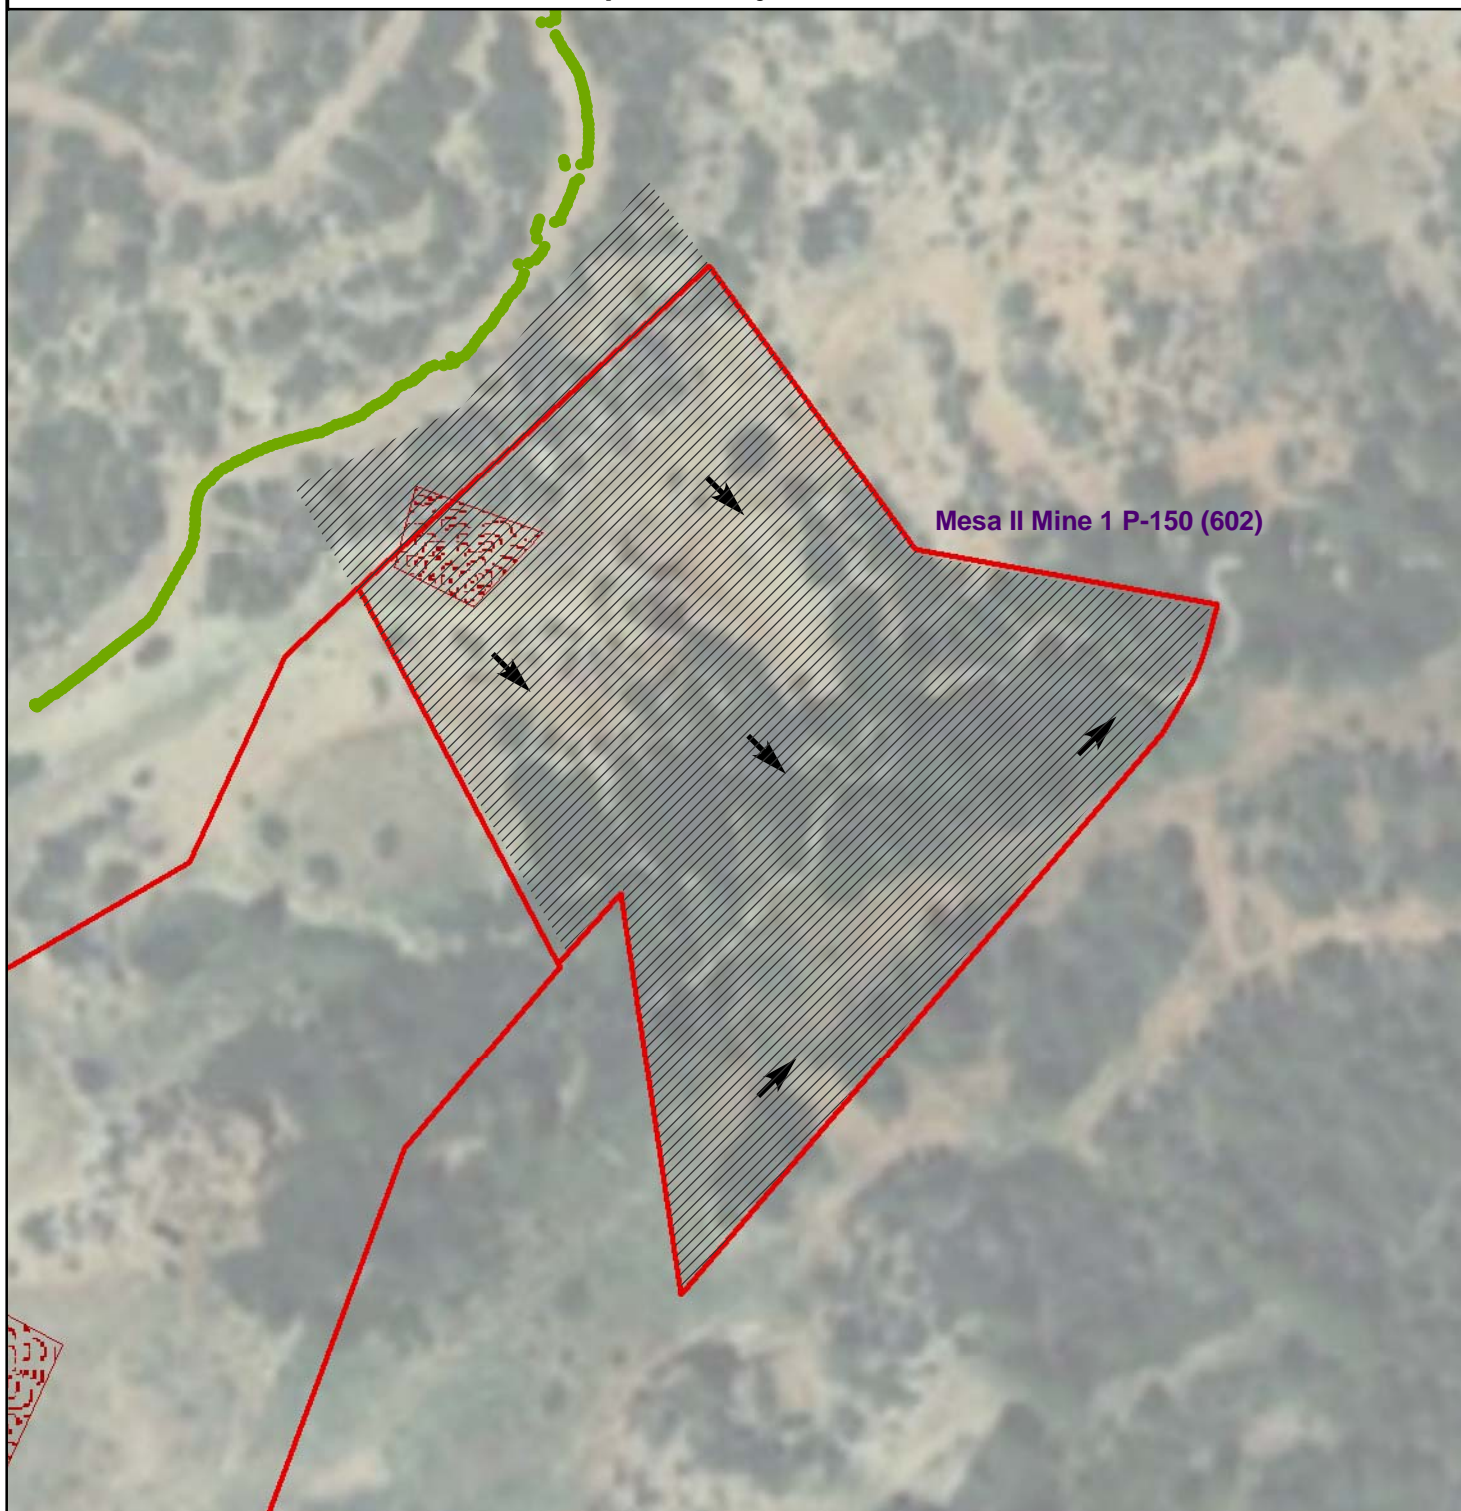

Mesa II Mine 1 P-150 (602)

### Legend

#### Gamma Radiation Measurements

- < 2X Background
- > 2X Background

Gamma survey conducted 10/2009  
Measured as counts per minute (cpm)

Average background = 7,906 cpm



Observed Waste Pile



Inaccessible due to steep grades



General Direction Down-Slope




Mine Claim Boundaries



**WESTON**  
SOLUTIONS

**Figure 2 - Gamma Radiation Measurements  
Mesa II Mine 1 P-150 (602)  
Cove Chapter, Navajo Nation, Arizona**

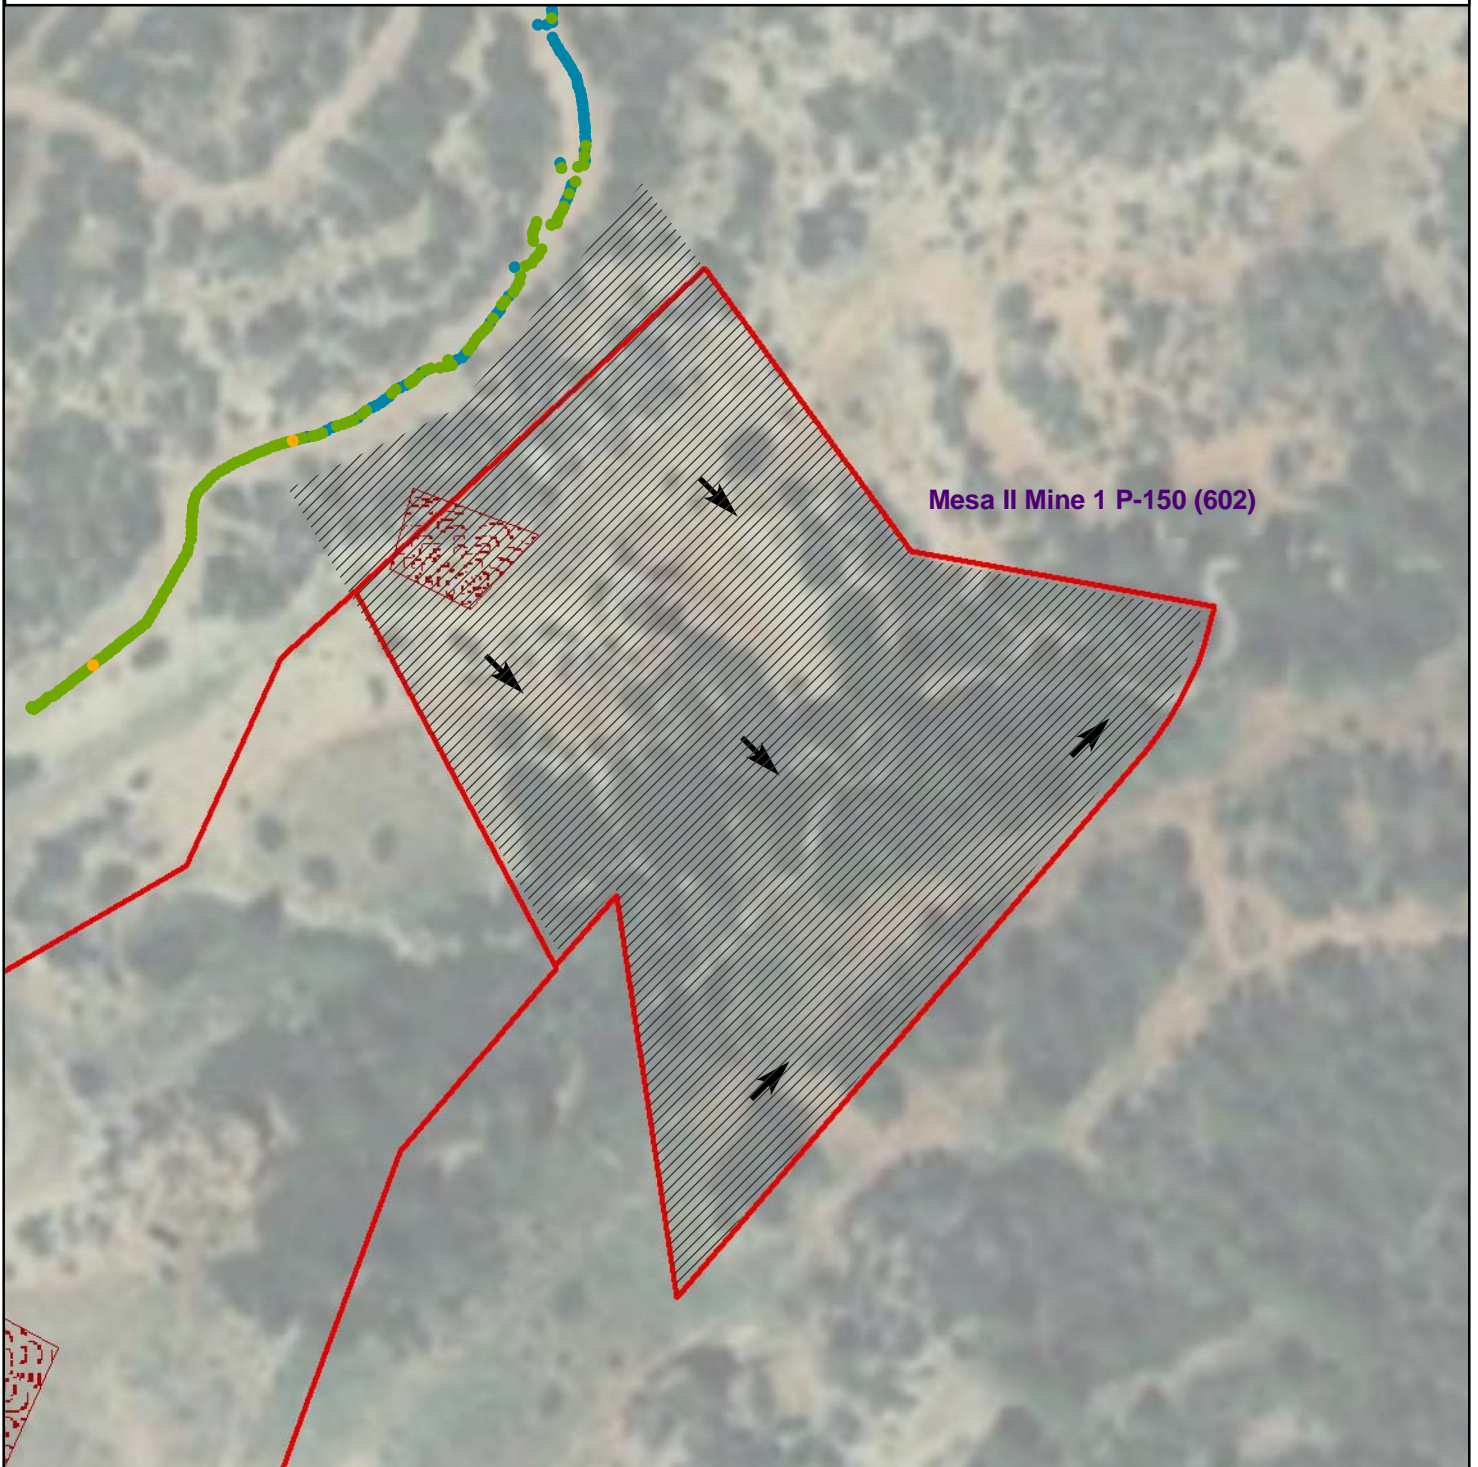

**Legend**

**Gamma Radiation Measurements**

- 0 - 10,000
- 10,000 - 15,000
- 15,000 - 20,000
- 20,000 - 50,000
- 50,000 - 100,000
- > 100,000



**Observed Waste Pile**



**Inaccessible due to steep grades**



**General Direction Down-Slope**



**Mine Claim Boundaries**

**Gamma survey conducted 10/2009  
Measured as counts per minute (cpm)**

**Average background = 7,906 cpm**



0 150 Feet

